

# Manhole Inspection Summary

Manhole # S15KK1021MH

Printed On: 12/17/2008

Page 1 of 5

**Inspection** ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **15KK1** Node: **021** Status: **Found**

Insp Date: **6/19/07 9:01 AM**

Incomplete Comments

Crew: **IB, FW**  
Inspector: **Bailey, I**  
Firm: **PER**

**Location** Address: **2530 EDGECOMBE CIR N**

Cross Street: **DERBY MANOR DR**

**Manhole** Type: **Junction**

Location: **Grass**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **None**

Comments **MH LOC. BEHIND APT. BUILDINGS..**

**Cover**

Shape: **Circular**

Diameter: **24** (in.) Length: (in.) Dist A/B Grade: **12** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

**Frame**

Offset: **0** (in.)

Condition: ☐ Sound

☐ Cracked

☒ **Leaks**

**Chimney / Frame Adjustment**

☒ Exists Material: **Brick**

☐ Parged Height: **6** (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☒ **Deteriorated**

Infiltration: ☐ None ☒ **Joint** ☐ Cracks ☐ Mortar ☐ Roots ☒ **Wall**

**Corbel**

Material: **Brick**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☒ **Mortar** ☐ Roots ☒ **Wall**

**Barrel**

Material: **Brick**

☐ Parged

Shape: **Circular**

Diameter: **42** (in.) Length: (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☒ **Mortar** ☐ Roots ☒ **Wall**

**Bench**

☒ Exists Material: **Brick**

☐ Parged

☒ **Debris** (not Condition related)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Channel**

Material: **Brick**

☐ Parged

☒ **Debris** (not Condition related)

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Steps**

Count: **5** Missing: **0** ☒ **Corroded**

**Surcharge**

☐ Evidence Of Surcharge

Depth: **4.5** (ft.)

☐ Active Surcharge Present

Location View



Top View



Corroded steps. Bench and Channel debris.

Defect



Barrel infiltration.

Defect



Adjustment deterioration and infiltration. Corbel and Barrel infiltration.

Defect



Adjustment deterioration and infiltration. Corbel and Barrel infiltration - other side.

## Manhole Inspection Summary

Manhole # S15KK1021MH

Printed On: 12/17/2008

Page 3 of 5

### 8 in. Circular Gravity Sewer Pipe Out @ 12 O'Clock



Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **12.02** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ **Mud** ☐ Sludge ☐ **Debris** ☐ **Grease**

Silt Depth: (in.) Deposits Extent:

Infiltration: **Evidence** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

### 8 in. Circular Gravity Sewer Pipe In @ 3 O'Clock



Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **8.34** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ **Mud** ☐ Sludge ☐ **Debris** ☐ **Grease**

Silt Depth: (in.) Deposits Extent:

Infiltration: **Evidence** Pipe Seal Cond: **Unknown**

### Drop In @ 3 O'Clock



Drop: **Outside** Rod and Bar

Angled: **Yes** Reading: **10.24** (ft.)

Inv Depth: **11.24** (ft.)

Drop Condition: **Open**

Connects To: **Manhole**

☐ Possible Illicit Connection

## Manhole Inspection Summary


Manhole # S15KK1021MH

Printed On: 12/17/2008

Page 4 of 5

### 6 in. Circular Gravity Sewer

Pipe In @ 6 O'Clock

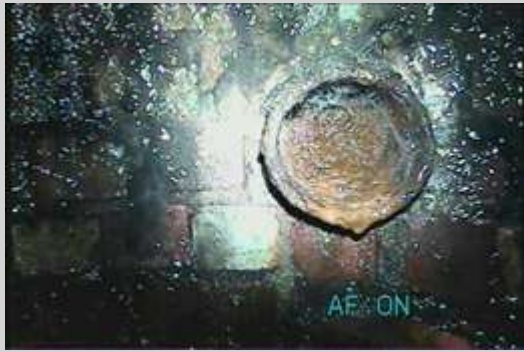

Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **10.15** (ft.) Flow Characteristics: **None**

Deposits: ☐ None ☒ Mud ☐ Sludge ☒ Debris ☒ Grease

Silt Depth: **1.5** (in.) Deposits Extent: **Light**

Infiltration: **Evidence**

Pipe Seal Cond: **Unknown**

Drop In @ 6 O'Clock



Drop: **None**

Connects To: **House connection / Service line**

☐ Possible Illicit Connection

### 6 in. Circular Gravity Sewer

Pipe In @ 7 O'Clock



Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **10.00** (ft.) Flow Characteristics: **None**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **Evidence**

Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **House connection / Service line**

☐ Possible Illicit Connection

## Manhole Inspection Summary

Manhole # S15KK1021MH

Printed On: 12/17/2008

Page 5 of 5

8 in. Circular Gravity Sewer

Pipe In @ 8 O'Clock



Rod and Bar (Angled)

Pipe Material: **Clay**

☐ Pipe Lined

Invert Depth: **11.23** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.)

Deposits Extent:

Infiltration: **Evidence**

Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Dead End**

☐ Possible Illicit Connection